Formula Page

On this page I have posted Tesla coil formulas for a reference to those who prefer to make calculations on paper. Below is a table of formulas on this page.

Ohm's Law	Transformer Input and Output	Capacitive Reactance
Inductive Reactance	Resonant Circuit Formula	Spiral Coil
Helical Coil	Inverse Conical Coil	Secondary Coil Dimensions
Medhurst	Toroid Capacitance	Sphere Capacitance
Plate Capacitors	Leyden Jar Capacitors	AC RMS/Peak Voltage
Rotary Gap Firing	Rotary Gap Electrode Speed	Energy for L and C

Ohm's Law

$$E = IZ$$

$$P = IE$$

E = volts

I = current in amps

Z = impedance or resistance in ohms

P = power in watts

Transformer Input and Output

$$E_pI_p = E_sI_s$$

 $E_p = primary voltage$

 I_p = primary current in amps

 E_S = secondary voltage

 I_S = secondary current in amps

Capacitive Reactance

$$X_c = \frac{1}{2\pi FC}$$

 X_C = capacitive reactance in ohms

F = frequency in hertz

C = capacitance in farads

Inductive Reactance

$$X_L = 2\pi FL$$

 X_L = inductive reactance in ohms

F = frequency in hertz

L = inductance in henrys

Resonant Circuit Formula

$$4\pi^{2}F^{2}LC = 1$$

$$F = \frac{1}{2\pi\sqrt{LC}}$$

F = frequency in hertz

L = inductance in henrys

C = capacitance in farads

Spiral Coil Inductance


$$L = \frac{(NR)^2}{8R + 11W}$$

L = inductance of coil in microhenrys (μ H)

R = average radius of the coil in inches

N = number of turns

W = width of the coil in inches

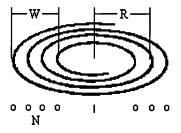

Helical Coil Inductance


$$L = \frac{(NR)^2}{9R + 10H}$$

 $L = inductance of coil in microhenrys (<math>\mu H$)

N = number of turns

R = radius of coil in inches (Measure from the center of the coil to the middle of the wire.)

H = height of coil in inches

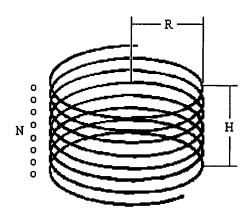

Inverse Conical Coil Inductance

$$L_1 = \frac{(NR)^2}{9R + 10H}$$
 $L_2 = \frac{(NR)^2}{8R + 11W}$

$$L = \sqrt{(L_1 \sin(x))^2 + (L_2 \cos(x))^2}$$

 $L = inductance of coil in microhenrys (<math>\mu H$)

 L_1 = helix factor

 L_2 = spiral factor


N = number of turns

R = average radius of coil in inches

H = effective height of the coil in inches

W = effective width of the coil in inches

X = rise angle of the coil in degrees

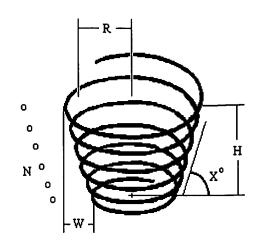

Secondary Coil Dimensions

$$L = \frac{\pi DAH}{12}$$

$$T = AH$$

$$A = \frac{1}{B}$$

L = length of wire in feet

D = outer diameter of coil form in inches

H = height of windings in inches

A = number of turns per inch

T = total number of turns

B = thickness of wire in inches

Medhurst

$$C = 0.29 L + 0.41 R + 1.94 \sqrt{\frac{R^3}{L}}$$

C = self capacitance in picofarads

R = radius of secondary coil in inches

L = length of secondary coil in inches

Toroid Capacitance

$$C = 1.4 \left(1.2781 - \frac{D_2}{D_1} \right) \sqrt{\pi D_2(D_1 - D_2)}$$

C = capacitance in picofarads

 D_1 = outside diameter of toroid in inches

 D_2 = diameter of cross section of toroid in inches

This equation courtesy Bert Pool.

Sphere Capacitance

$$C = \frac{25.4 \,\mathrm{R}}{9}$$

C = capacitance in picofarads

R = radius in inches

Plate Capacitors

$$C = \frac{0.224 \text{KA}(\text{N} - 1)}{1,000,000 D}$$

C = capacitance in microfarads

K = dielectric constant

A = area of each plate in square inches

N = number of plates

D = distance between plates in inches (thickness of dielectric)

Leyden Jar Capacitors

$$C = \frac{0.224 \pi KD(H + 0.25D)}{1,000,000T}$$

C = capacitance in microfarads

K = dielectric constant

D = diameter of jar in inches

H = height of jar in inches

T =thickness of jar in inches

AC RMS and Peak Voltage

$$E_{RMS} = 0.7071 \cdot E_{P}$$

$$E_{RMS} = RMS$$
 voltage

$$E_p = peak voltage$$

Rotary Spark Gap Firings per Second

$$F = \frac{RE}{60}$$

F = firings per second (hertz)

R = motor RPM rating

E = number of rotary electrodes

Rotary Spark Gap Electrode Speed

$$S = \frac{\pi RD}{1056}$$

S = electrode speed (MPH)

R = motor RPM rating

D = diameter of electrode placement circle (inches)

Energy for L and C

Capacitance

Inductance

 $J = 0.5 V^2 C$

 $J = 0.5 I^2 L$

J = joules of energy stored

V = peak charge voltage

I = peak current

C = capacitance in farads

L = inductance in henries

I stated peak values of V and I because I want to emphasize not to use RMS values. The energy stored at any given time is of course: $J(t) = 0.5 [V(t)]^2 C$ and $J(t) = 0.5 [I(t)]^2 L$.

How a Tesla Coil Works | Calculations | Formulas | Construction | Modeling | Java Calculator | Safety | Pictures |
Specifications | About Me | Download | Links | Other Projects

Back to homepage.

ElectronXLC@earthlink.net

Copyright © 1998-2001, Matt Behrend, All Rights Reserved.